

HÜBNER Analog-Tachos


Hohlwellen-Tachos / *Hollow-shaft generators*

Montage- und Betriebshinweise

Installation and operating instructions

HÜBNER
ELEKTROMASCHINEN AG
BERLIN

GTL 5.05

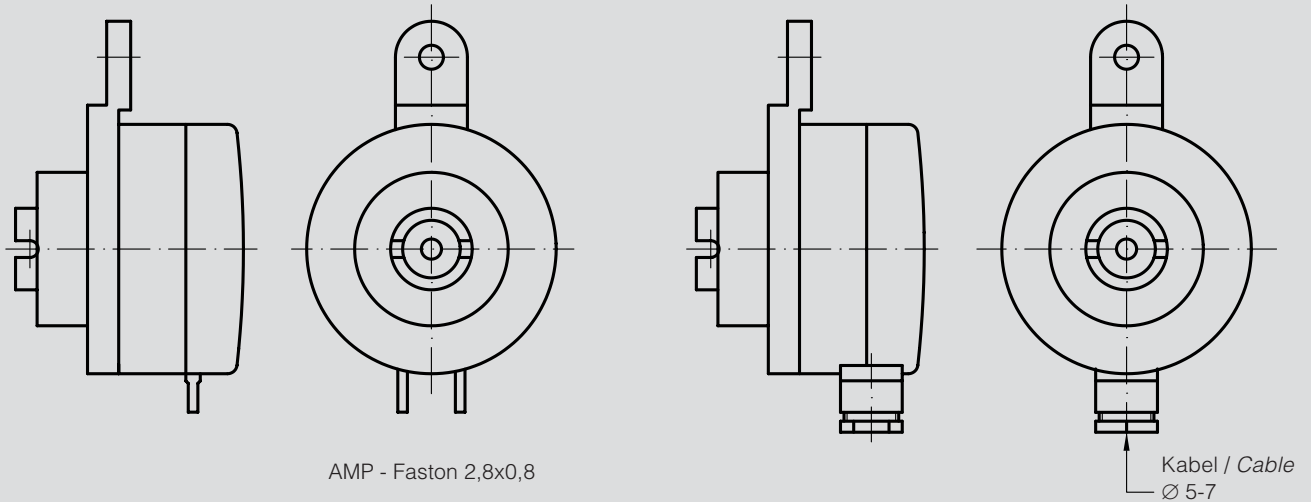


Wichtige Hinweise

- Analog-Hohlwellen-Tachos (Tacho-Dynamos) sind **Präzisions-Drehzahlmessgeräte**, die beim Transport, beim Anbau und während des Betriebes mit Sorgfalt nur von technisch qualifiziertem Personal gehandhabt werden dürfen.
- Der **Anbau** an die Antriebsmaschine muss mit möglichst geringem Winkelfehler und Parallelversatz erfolgen.
- Die **Drehmomentstütze** muss rechtwinklig zur Welle spannungsfrei montiert werden.
- Zur Gewährleistung der angegebenen **Schutzart** sind nur geeignete **Kabeldurchmesser** zu verwenden.
- LongLife®-DC-Tachos sind **wartungsfrei**. Lebensdauer der Kohlebürsten unter normalen Bedingungen $\geq 10^9$ Umdrehungen. Ein Wechsel der Kohlebürsten ist nur vorsorglich erforderlich. Bei Erreichen der minimalen Bürstenlänge von 4,5 mm sollten die Bürsten ausgewechselt sowie der Kommutatorraum mit trockener Pressluft ausgeblasen werden, damit weiterhin ein einwandfreier Betrieb gewährleistet ist.
- **EG Konformitätserklärung** gemäß Richtlinie 89 / 336 / EWG Artikel 10 - sowie Anhang 1 (EMV-Richtlinie).


Important Notice

- Analog hollow-shaft tachogenerators are **precision speed measurement devices**, which must be handled by skilled personnel with care during transportation, mounting and operation.
- They should be **mounted** to the drive machine with a minimum of angle error and parallel misalignment.
- The **torque arm** should be mounted perpendicular to the shaft without stress.
- To maintain the specified degree of **protection** of the device the correct **cable diameter** must be used.
- LongLife® dc tachogenerators are **free of maintenance**. Life time of the carbon brushes under normal conditions $\geq 10^9$ revolutions. Replacement of the carbon brushes is only a recommended precaution. When the minimum brush length of 4,5 mm is reached, the brushes should be replaced and the commutator area should be cleaned with dry compressed air in order to ensure perfect operation.
- **EU Declaration of Conformity** acc. to Council Directive 89-336-EEC art. 10 and annex 1 (EMC directive).




	Ident-Nr. Part no. H 87	Ident-Nr. Part no. AG 35	Stück Pieces	Kugellager Ball bearings 3803 2Z
Kohlebürsten Carbon brushes	ET.26.1001	ET.26.1000	4	

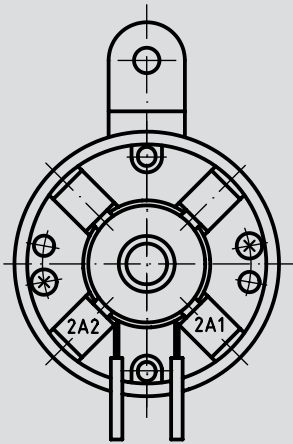



AMP - Faston 2,8x0,8

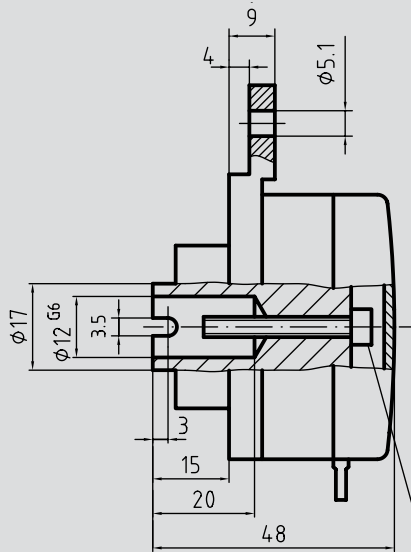

M4 x 30 - ISO 7045
 A4 - ISO 7090
 zul. Anzugsmoment
 Admissible tightening torque
 $M_t = 3 \text{ Nm}$

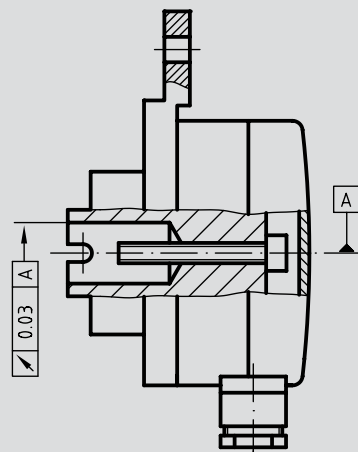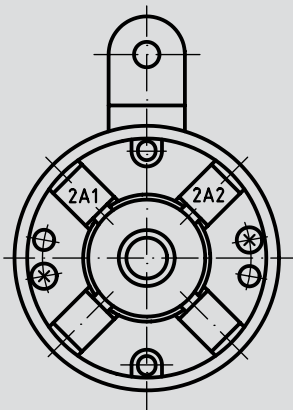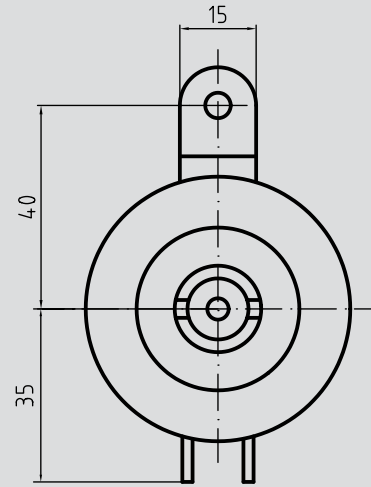

Kabel / Cable
 $\text{Ø } 5-7$

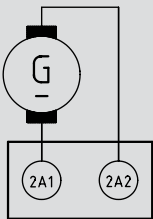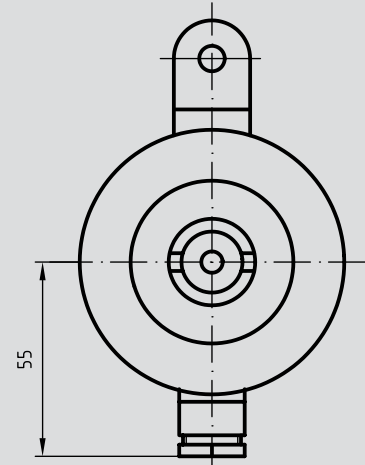

Polarität bei Rechtslauf des Antriebes, Blick auf die A-Seite
 Polarity for clockwise rotation of the drive, viewing mounting face

2A1: + (VDE)
 2A2: -